

Date: Friday, 1/25/2008 10:50:50 AM  
 User: Kim Johnston

## Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 206L FWD X-TUBE  
 Job Number : 36968  
 Estimate Number : 10553  
 P.O. Number :  
 This Issue : 1/25/2008 S.O. No. :  
 Prsht Rev. : NC Part Number : D206667103 *TRN*  
 First Issue : 1/1 Type : LANDING GEAR Drawing Number : D206-667-143 REVB  
 Previous Run : 36378 Project Number : N/A  
 Material :  
 Due Date : 3/10/2008 Qty: 1 Um: Each  
 Written By :  
 Checked & Approved By : *JA 080125*  
 Comment : Est Rev E 05.09.01 Add holes for compatibility with Bell  
 Skidtubes KJ/JLM

## Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D206-667-103 CHG002

2.0

D6002115

Crosstube material



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part number

Description Batch

1 D6002-115

Crosstube

*834684*

Check OD = 2.250"; ID = 1.750"

*20 08/03/04*

3.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand &amp; install plugs DT8534 on both ends as per Folio FA087

2-Turn first side as per Folio FA087

3-Deburr &amp; Inspect for surface damage. Repair damage within limits as per Dwg D206-667-143.

*20 08/03/04*

4.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

*20 08/03/04*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 1/25/2008 10:50:50 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 36968

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA087

2-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D206-667-143.

3-Remove sand and plugs

4-Scribe part # and batch # using vibrating stylus as per Dwg D206-667-143

Inside of Cuff(Donot engrave on outside of tube)

20 08/03/04 ①

6.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

20 08/03/04 ①

7.0

QC8

SECOND CHECK



Comment: SECOND CHECK

MR 08/03/04 ①

8.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

ALM 8-3-11

1-Polish entire outside surface of crosstube

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/03/11 ①

10.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

08 8-3-11

11.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

Bend tube as per Dwg D206-667-143 using CNC Bender program 206L-fw and Folio FT017

NIA

JD + STK

DP 8-4-2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 1/25/2008 10:50:50 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 36968

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

QC15

DIMENSIONAL CHECK OF X-TUBES



Comment: DIMENSIONAL CHECK OF X-TUBES

13.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes in tube using drill Jig DT8541 & DT8542 as per Dwg D206-667-143. Drill all (3) top holes.

2-Drill and Ream all holes in tube to finish size using drill Jig DT8541 & DT8542 as per Dwg D206-667-143. Check dimensions between holes on all four sides.

3-Flip tube and switch drilling Jigs from right to left, left to right. Locate Jigs off existing holes using "T" pins.

4-Drill pilot holes using drill Jig DT8541 & DT8542 as per Dwg D206-667-143. Drill only the top (2) holes.

5-Drill & ream the top (2) holes to finish size using drill Jig DT8541 & DT8542 as per Dwg D206-667-143

6-Drill Fwd rivet holes using drill Jig DT8787FWD as per Dwg D206-667-143. Note: Fwd side has 3x top holes.

7-Drill Aft rivet holes using drill Jig DT8787AFT as per Dwg D206-667-143.

8-C'sink holes as per Dwg D206-667-143. Allow rivet to sit below surface to compensate for paint.

9-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D206-667-143

14.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

15.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 1/25/2008 10:50:50 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 36968

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

17.0

OUTSIDE SERV.10

OUTSIDE SERVICES -LG



Comment: Sub-Contracting OUTSIDE SERVICES  
Liquid Penetrant Inspection as per QSI 0380r  
Issue P/O: \_\_\_\_\_ LPI as per ASTM 1417  
Level 2 Attach copy of NDT results to work order

18.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1  
Inspect for transit damage  
Ensure copy of NDT results attached to work order.

19.0

QC6

DIMENSIONAL CHECK



Comment: Inspect for damage & ensure results are as per Dwg.D206-667-103

20.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube with White Imron as per QSI 005 4.2 - -

21.0

QC14

INSPECT SPRAY PAINT



Comment: Inspect Spray Paint  
Wrap in plastic bag to protect from scratches

22.0

D2856400

Abrasion Strip



Comment: Qty.: 1.2138 f(s)/Unit Total : 1.2138 f(s)  
Pick:  
Qty Part number Description Batch  
2 D2856-400(Cut to 6.94") Abrasion Strip \_\_\_\_\_

23.0

D2873043

Nut Plate Assembly



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)  
Pick:  
Qty Part number Description Batch  
2 D2873-043 Nut Plate \_\_\_\_\_

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Friday, 1/25/2008 10:50:50 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 36968

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

24.0

D2873045

Nut Plate Assembly



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2873-045 Nut Plate

25.0

D28911

Support 2.25 dia



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2891-1 Support

26.0

MS20601AD4W8

RIVET



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

Pick:

Qty Part number Description Batch

14 MS20601AD4W8 Rivet

27.0

MS2192020

Clamp (per MIL-DTL-8783C)



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part number Description Batch

4 MS21920-20 Clamp

28.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Install abrasion strips as per QSI 035 using DT8579. Note: (2) Aft holes should be facing up.

2-Install supports and clamps as per Dwg D4206-667-143. Torque clamps to 80-100 in lb

3-Install nut plates as per Dwg D206-667-143. Touch-up rivet heads with Imron paint.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 1/25/2008 10:50:50 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 36968

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

29.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

30.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1  
Pick Packing Kit

31.0

AN532A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)  
Bolt  
Batch: \_\_\_\_\_

32.0

MS21042L5

Nut



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)  
Nut  
Batch: \_\_\_\_\_

N/A

33.0

AN57A

Bolt



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)  
Pick:Packing Kit  
Qty Part number Description Batch  
10 AN5-7A Bolt \_\_\_\_\_

34.0

AN530A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)  
Pick:Packing Kit  
Qty Part number Description Batch  
4 AN5-30A Bolt \_\_\_\_\_

35.0

AN960JD516

Washer



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)  
Pick:Packing Kit  
Qty Part number Description Batch  
18 AN960JD516 Washer \_\_\_\_\_

# Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 1/25/2008 10:50:50 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 36968

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

36.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

37.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-667-103

Location: \_\_\_\_\_

PPP Rev: \_\_\_\_\_

38.0

QC21

FINAL INSPECTION/W/O RELEASE



D 08/04/02

Comment: FINAL INSPECTION/W/O RELEASE

NEW KAN BAN System

Job Completion



W 08-24-02

# Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

<b>DART AEROSPACE LTD</b>	<b>Work Order:</b>	36968
<b>Description:</b> Crosstube Assembly (206L High Fwd)	<b>Part Number:</b>	D206-667-143
<b>Inspection Dwg:</b> D206-667-143 <b>Rev:</b> B		<b>Page 1 of 1</b>

### FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article
 ☐ Prototype


Inspection Sheet	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000	2.245	✓			
	1.982	+0.005/-0.000	1.987	✓			
	2.019	+0.005/-0.000	2.024	✓			
	2.058	+0.005/-0.000	2.063	✓			
	2.097	+0.005/-0.000	2.102	✓			
	2.136	+0.005/-0.000	2.141	✓			
	2.176	+0.005/-0.000	2.181	✓			
	2.201	+0.005/-0.000	2.205	✓			
	0.125	+/-0.010	.125	✓			
	0.400 x 30°	+/-0.010	.400	✓			
	R0.063	+/-0.010	.063	✓			
	R0.500	+/-0.010	.500	✓			
	4.438	+/-0.030	4.438	✓			
SIDE B	104.98	+/-0.020	104.98	✓			
	2.240	+0.005/-0.000	2.245	✓			
	1.982	+0.005/-0.000	1.987	✓			
	2.019	+0.005/-0.000	2.024	✓			
	2.058	+0.005/-0.000	2.063	✓			
	2.097	+0.005/-0.000	2.102	✓			
	2.136	+0.005/-0.000	2.141	✓			
	2.176	+0.005/-0.000	2.181	✓			
	2.201	+0.005/-0.000	2.201	✓			
	0.125	+/-0.010	.125	✓			
	0.400 x 30°	+/-0.010	.400	✓			
	R0.063	+/-0.010	.063	✓			
	R0.500	+/-0.010	.500	✓			
	4.438	+/-0.030	4.438	✓			

<b>Measured by:</b> <i>RP</i>	<b>Audited by:</b> <i>[Signature]</i>	<b>Prototype Approval:</b>	N/A
<b>Date:</b> 08/03/04	<b>Date:</b> 08/03/06	<b>Date:</b>	N/A

Rev	Date	Change	Revised by	Approved
A	04.05.06	New Issue (P/O D206-667-103)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM <i>[Signature]</i>	<i>[Signature]</i>

<b>DART AEROSPACE LTD</b>		<b>Work Order:</b>	36968
<b>Description:</b> Crosstube High Fwd (206L)		<b>Part Number:</b>	D206-667-103
<b>Inspection Dwg:</b> D206-667-143 <b>Rev:</b> B		<b>Page 1 of 1</b>	

Required Dimension	Min	Max
Height	23.46	23.58
1/2 Span	41.86	41.98
Angle	54	56
Total Span	83.72	83.96

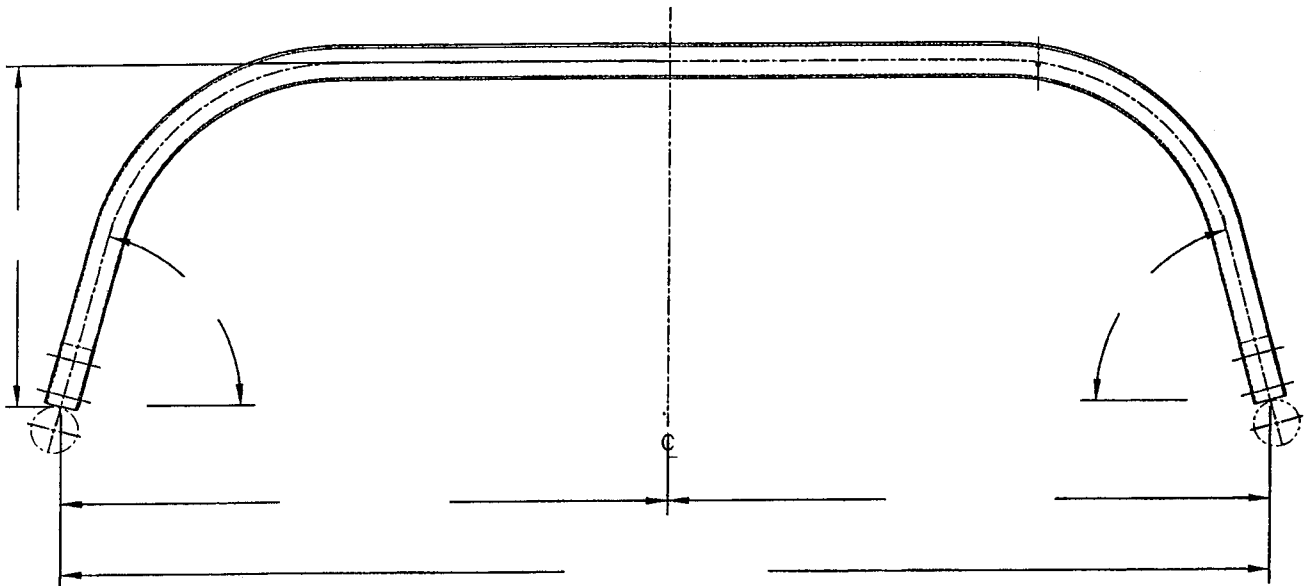

Comments

QC15 Inspection	
Date	

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	<i>[Signature]</i>





DESIGN PH	DRAWN BY PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED HDS	APPROVED HDS	DRAWING NO. D206-667-143	REV. B SHEET 1 OF 3
DATE 05.07.26		TITLE CROSSTUBE ASS'Y (206L HIGH FWD) NTS	
A	00.11.17	NEW ISSUE	
B	05.07.26	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	

RELEASED  
05-07-26 HDS

**UNDER REVIEW**

05-07-10 PH

re-draw detail F  
PH

07.05.02

Qty	Part Number	Description
X	D206-667-143	CROSSTUBE ASSEMBLY (206L HIGH FWD)
1	D6002-115	CROSSTUBE
2	D2873-043	NUT PLATE
2	D2873-045	NUT PLATE
2	D2856-400-694	ABRASION STRIP
2	D2891-1	SUPPORT
14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
4	MS21920-20	CLAMP

#### GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) MATERIAL: MANUFACTURED FROM D6002-115  
FINISHED LENGTH =  $104.98 \pm 0.020$
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE.
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 6) BEND PROGRESSIVELY WITH A MINIMUM OF 10 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2856-400-694 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF CROSSTUBE, CENTERED OPPOSITE D2891-1 SUPPORT, PER QSI 035.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) IT IS OPTIONAL TO SEAL EDGES OF SUPPORTS AND ABRASION STRIP USING SIKAFLEX 241/291 SEALANT.
- 12) TORQUE CLAMPS 80 TO 100 IN-LB.

SHOP COPY

THE TURN TO

ENGINEERING

UNCONTROLLED COPY






SUBJECT TO AMENDMENT

WITHOUT NOTICE

WORK ORDER  
NO. 36968

Copyright © 2000 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

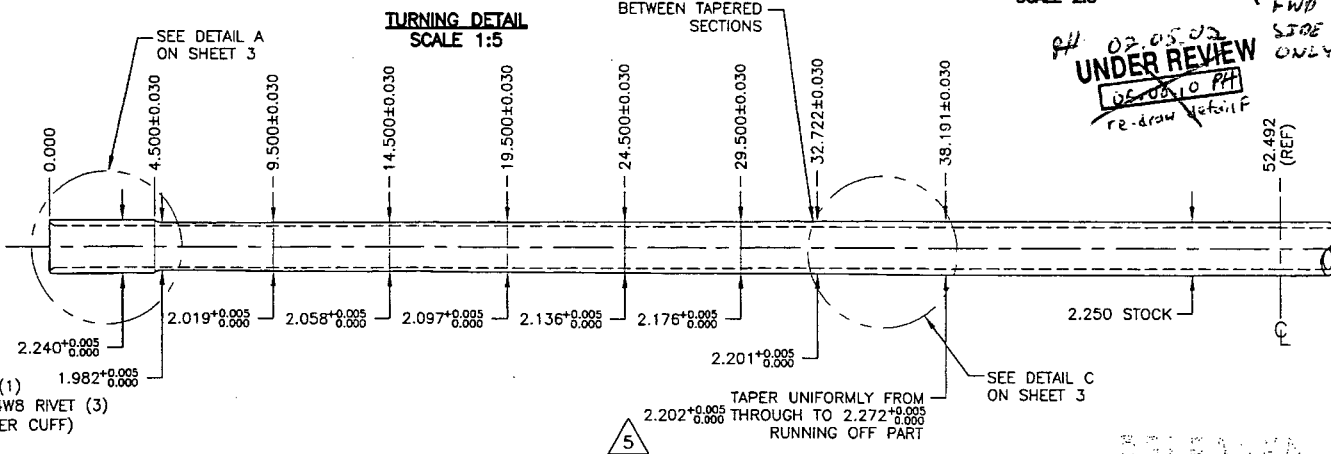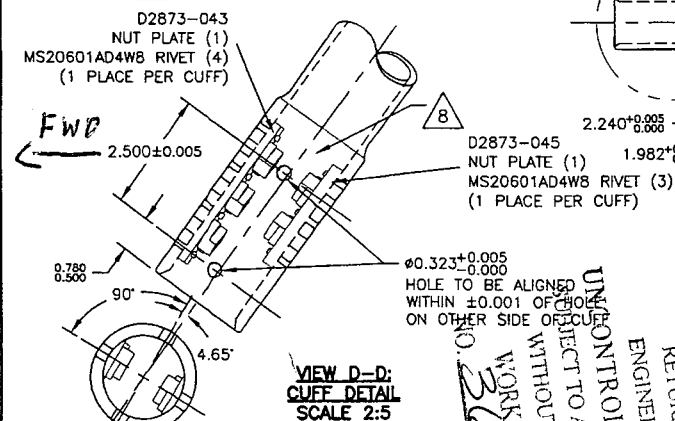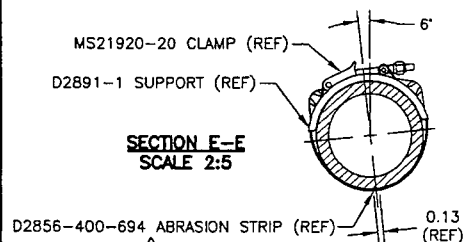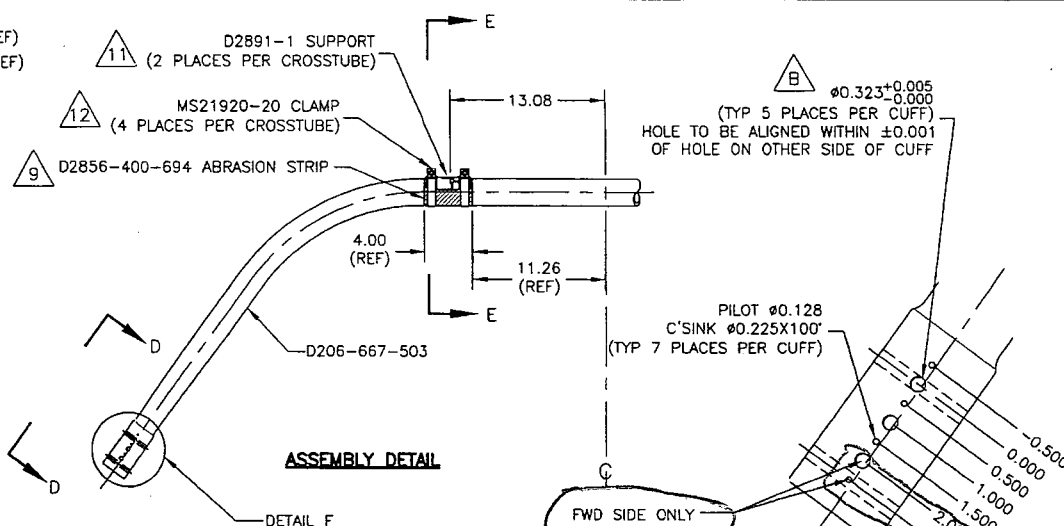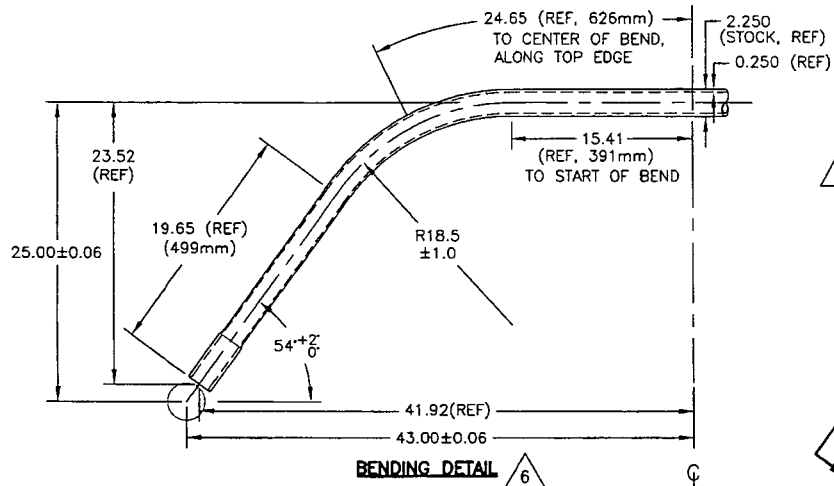


COPYRIGHT © 2000 BY DART AEROSPACE LTD.		DESIGN	DRAWN BY	<b>DART</b> DART AEROSPACE LTD. HAWKESBURY, ONTARIO, CANADA	REV. B
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		PH	PH		
CHECKED		PH	PH	DRAWING NO.	SHEET 2 OF 3
DATE		PH	PH	D206-667-143	
05.07.26		TITLE		CROSSTUBE ASS'Y (206L HIGH FWD)	SCALE
					1:10

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 36968


05-07-26-4

# DETAIL A: CROSSTUBE CUFF

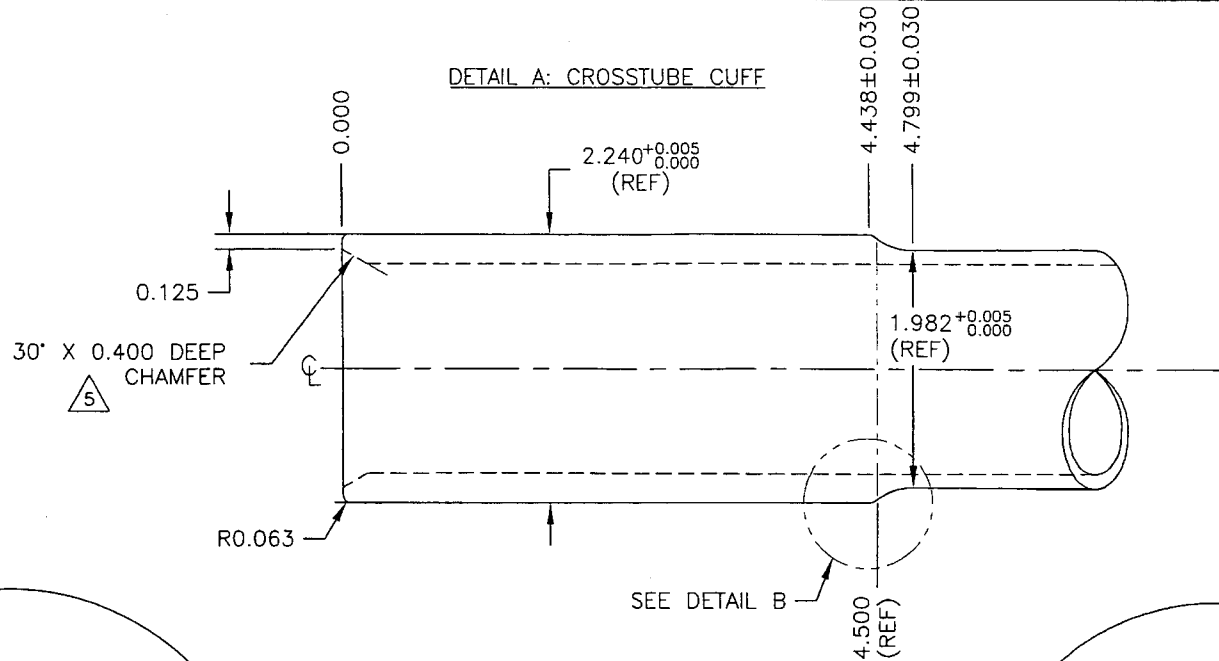


05.07.26 #  
 UNDER REVIEW  
 06.07.26 PH  
 PH 07.05.02

## DETAIL B: CUFF TRANSITION SCALE 4:1

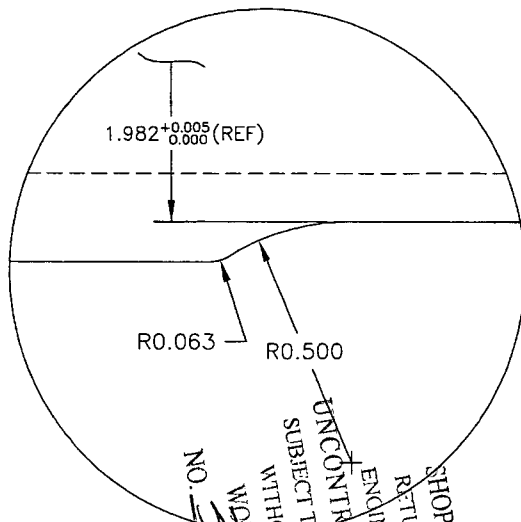

## DETAIL C: TAPER RUN-OFF NOT TO SCALE

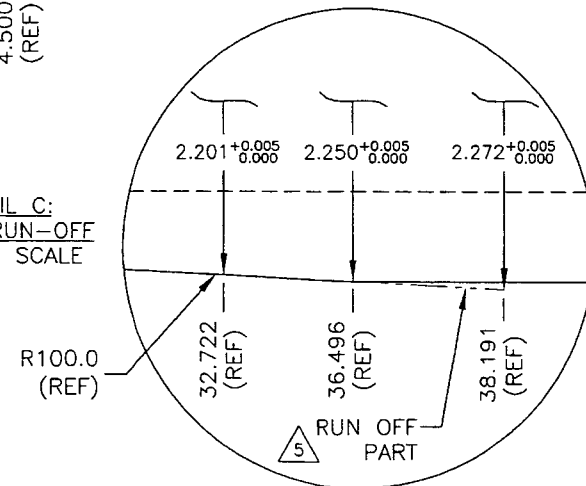

NO. 36928  
 WORK ORDER  
 SUBJECT TO AMENDMENT  
 WITHOUT NOTICE  
 UNCONTROLLED COPY  
 ENGINEERING  
 RETURN TO  
 SHOP COPY

COPYRIGHT © 2000 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL  
 AND IS SUPPLIED ON THE EXPRESS CONDITION  
 THAT IT IS NOT TO BE USED FOR ANY PURPOSE  
 OR COPIED OR COMMUNICATED TO ANY OTHER  
 PERSON WITHOUT WRITTEN PERMISSION FROM  
 DART AEROSPACE LTD.

DESIGN PH	DRAWN BY PH	<b>DART</b>	DART AEROSPACE LTD. HARRISBURG, ONTARIO, CANADA
CHECKED HDS	APPROVED HDS	DRAWING NO. D206-667-143	REV. B SHEET 3 OF 3
DATE 05.07.26	TITLE CROSSTUBE ASS'Y (206L HIGH FWD)	SCALE 1:1	